

Date: 09. April 2018

Aura 8 - Important Firmware Update required to users of two Spektrum Satellite!

Dear Valued Customer,

We have become aware of a potential issue that the Aura may not always correctly Auto-Detect two Spektrum Remote (Satellite) Receivers as "A+B Diversity". If this occurred, the Aura would only use one of the Remote Receivers even though both Spektrum Remote (Satellite) Receiver's LEDs would be ON. This issue generally would cause a failure of the Spektrum specified range test, and if the Aura data was read back using the Aura Config Tool, it would not show A+B Diversity.

Flex Innovations is requiring all Dual/A+B Diversity Spektrum Remote (Satellite) Receiver users take these actions before further flights:

Note: In order to always correctly detect Spektrum Remote A+B Diversity, additional logic was added to the Spektrum Remote processing code. **If you see a flashing Red LED after updating to Firmware v1.6, this is an indication that you need to Re-Bind your Spektrum Remote Receivers.**

- Update the Aura Config Tool (if needed to 1.1.5.0)
- Update to the latest firmware (1.6) which eliminates this potential Auto-Detect issue.
- Perform a fresh remote receiver BIND
- Perform a 'new' Auto-Detect *-or-* Use the Aura Config Tool to confirm/set A+B Diversity
- Perform a new Range Test per Spektrum guidelines.

This firmware update is also recommended to all Aura users to prevent any potential issues should dual satellites be used in the future.

Detailed instructions can be found at this link:

Modellbau Lindinger GmbH
Industriestraße 10, 4565 Inzersdorf im Kremstal
Tel.: +437582/81313-0
Fax: +437582/81313-17
UID-Nr.: ATU69266037
FN 428459m Handels und Kreisgericht Steyr
IBAN: AT201860000016503179
BIC: VKBLAT2L

<http://wiki.flexinnovations.com/wiki/Aura/FirmwareUpdate16>

If you have any questions, please contact us:

flug@lindinger.at

We sincerely apologize for any inconvenience,

Best Regards,
Modellbau Lindinger

Modellbau Lindinger GmbH
Industriestraße 10, 4565 Inzersdorf im Kremstal
Tel.: +437582/81313-0
Fax: +437582/81313-17
UID-Nr.: ATU69266037
FN 428459m Handels und Kreisgericht Steyr
IBAN: AT201860000016503179
BIC: VKBLAT2L

www.lindinger.at